

1500V 350A MSD Assembly Instructions








Rev.	Date	Description
Α	2023/05/20	Initial Release

1: Installation Process

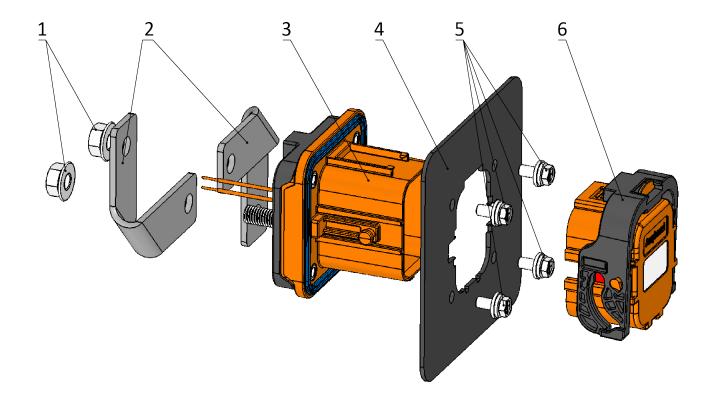

EXPLANATION


- 1. M8 Nut (Customer to prepare)
- 2. Soft copper plate (Customer to prepare)
- 3. MSD Receptacle
- 4. Installation panel (Customer to prepare)
- 5. M5 screws (Customer to prepare)
- 6. MSD plug

1: Mounting Requirements

When installing the receptacle, the customer needs to prepare 4* M5 screws assemblies (including spring washers and flat washers). Insert the receptacle through the mounting panel, secure the receptacle and mounting panel with 4* M5 screws, The recommended screw specifications are 8+A+Bmm, A is the thickness of the mounting panel, B is the thickness of the spring washer), the recommended installation torque is 5.0±0.5 N•m.

It is recommended the copper plate at the bottom of the receptacle be connected to the soft copper plate with M8 screws and the recommended tightening torque is (14±1) N•m.

Connect the plug to the receptacle.

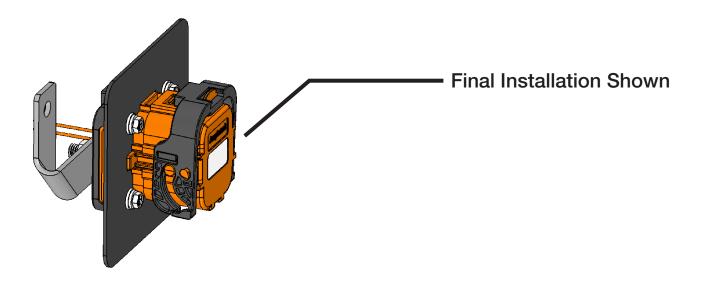

Recommended installation panel size for receptacle

